
SUBJECT: Marking of Rear Window by Linkage Cover

MODELS:

E30 Convertible with EM Top

Situation:

Some customers may complain of a marking or impression in the right side of the soft top rear window caused by the window contacting the metal linkage cover when the top is in the stowed position.

A new plastic cover with a modified contour has been developed to alleviate this problem.

Correction:

In case of complaint, replace the original metal cover with the new plastic cover as per the parts list below. Tighten bolts to 10 Nm and secure nuts with Loctite.

Parts Information:

Part Number	Description	Quantity
51 71 4 376 227	Cover	1
51 36 1 932 849	Bolt	2
07 11 9 921 104	Nut	2
51 48 1 905 599	Rivet	1

Warranty Status:

Covered under the terms of the BMW New Car Limited Warranty.

Defect Code: 54 31 03 54 00
Labor Operation: 00 51 505
Flat Rate Units: 3